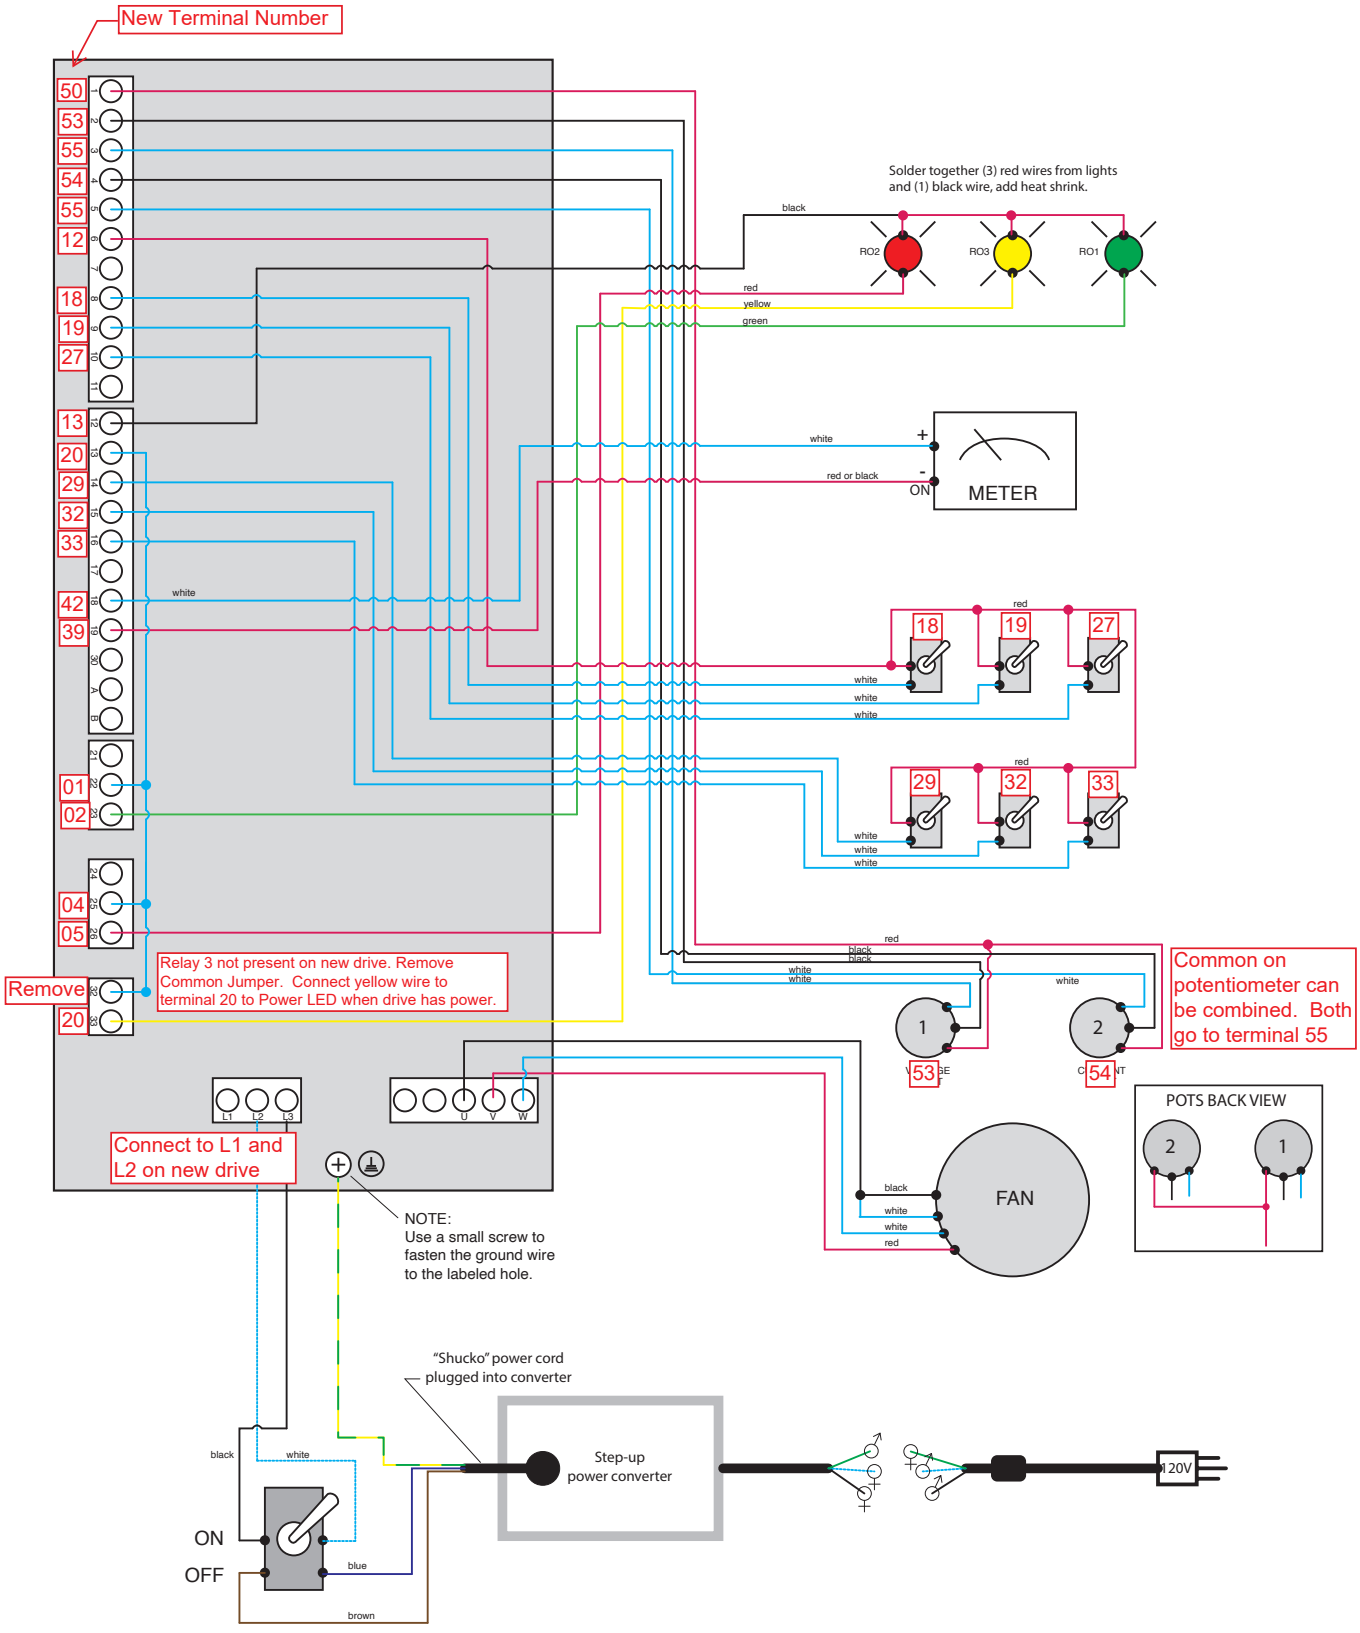
New Terminal Number
50
53
55
54
55
12
18
19
27
13
20
29
32
33
42
39
01
02
04
05
Remove
20
Relay 3 not present on new drive. Remove Common Jumper. Connect yellow wire to terminal 20 to Power LED when drive has power.
Solder together (3) red wires from lights and (1) black wire, add heat shrink.
black
RO2
RO3
RO1
red
yellow
green
white
red or black
+
-
ON
METER
white
red
18
19
27
white
white
white
red
29
32
33
white
white
white
red
black
black
white
white
white
1
2
53
54
Common on potentiometer can be combined. Both go to terminal 55
POTS BACK VIEW
2
1
L1
L2
L3
U
V
W
Connect to L1 and L2 on new drive
NOTE:
Use a small screw to fasten the ground wire to the labeled hole.
black
white
white
red
FAN
"Shucko" power cord plugged into converter
Step-up power converter
120V
black
white
ON
OFF
blue
brown